



## General instructions for use of CrystaLite's Quick Lock Assemblies

If wrapping corners with the use of 9066 or 9067 adaptor please be sure to read the installation instructions for Mitered Top Rail and or Top Rail Between Post fully understand installation procedures for your application.


1. Insert threaded terminal through post install female terminal adj. housing and washer on threaded terminal a couple threads just enough to keep nut from falling off.

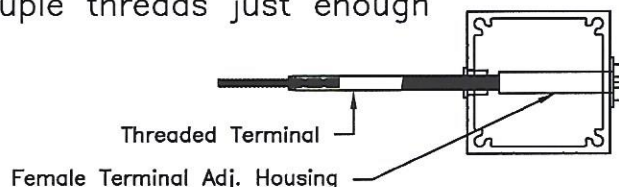

2. Thread cable with grommets through the posts. DO NOT insert grommets into the post at this time.
3. Run the cable through the Quick Lock post, DO NOT put the Quick Lock on the cable yet.
4. Insert grommets into post holes.
5. Starting at threaded terminal post pull cable tight working your way to the Quick Lock post.
6. Pull the cable tight along the outside of the Quick Lock post, with cable pulled tight, mark and cut the cable 1/2" from edge of post. Make sure the new cut cable end is wrapped tight, and there are no loose strands out of place.

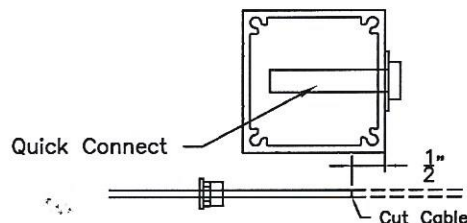

7. Insert cable through post and into Quick Lock. A SLIGHT twisting action may help ease cable into Quick Lock. Remove as much slack from the cable as possible.

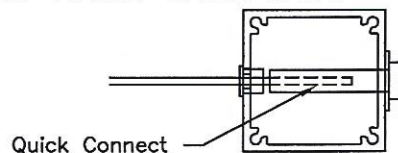

8. Finish tightening the cable assemblies from the threaded terminal end, using a pair of vise grips and a 3/16" allen wrench. Once cable tensioning is complete install 1/4" hole plug in Quick Lock, and 3/16" hole plug in the female terminal adj. housing. (Choice of black or white hole plugs)